


Safety Bulletin: Console plates of compensation cylinders TB270.4 (HV5), TB290.1 and TB300

As part of our market monitoring, we have noticed that improper operation or accidents involving the Steiger TB 270.4 (HV5), TB 290.1 and TB 300 can lead to deformation/damage to the console plates of the basket leveling cylinder. These can be caused by overload, for example, by the basket colliding with an obstacle while the Steiger is being operated or by a traffic accident.

In rare cases, this damage is not detected during visual inspection, so that failure of the connection cannot be ruled out during continued operation.

For this reason, particular attention must be paid to the integrity of the console plates during the daily visual inspection of the machine by the operating personnel. The console plates are clearly visible in the transport position.

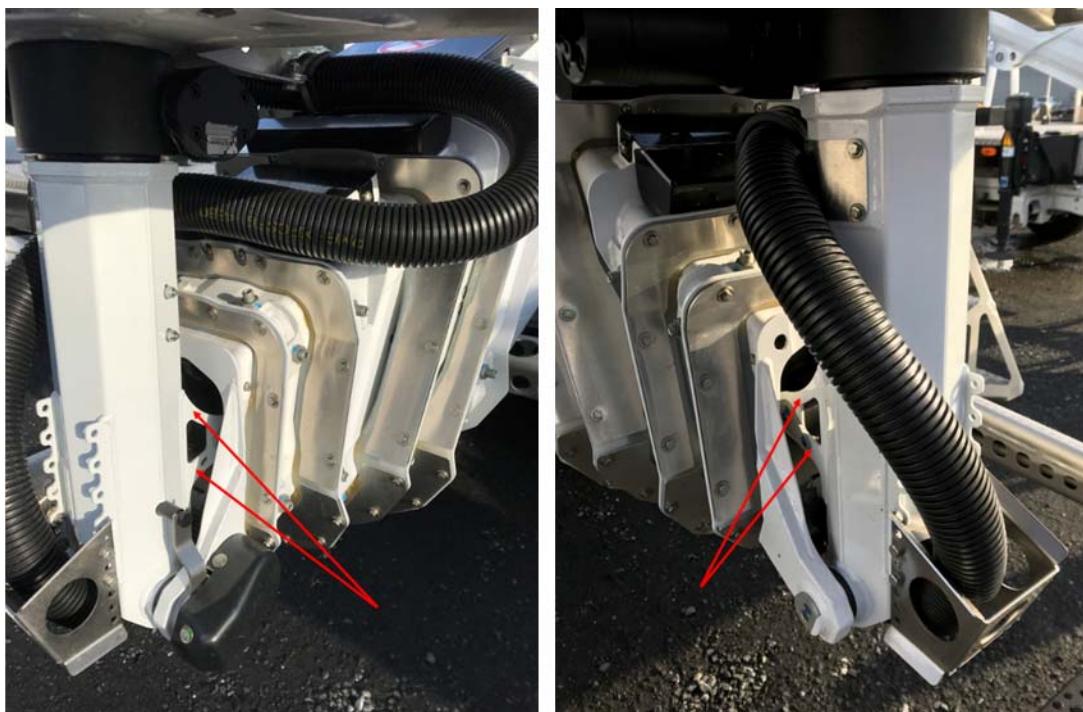

If there are noticeable deformations and/or cracks at the areas marked in the images, operation of the Steiger must be stopped and RUTHMANN Service contacted.

Contact: RUTHMANN Service
Fon: +49 2863 204-888
E-mail: support@ruthmann.de

state	Index	modification	date	name
40438	01	Added TB 270.4 HV5	08.01.26	pk
	date 09.01.2026	mod. pk	page 1	pages 1
		chk. tw		
	description	Safety Bulletin, English TB270.4 (HV5), TB290.1, TB300		
Drawing number 0927000100				